



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D2580-1
Job Sheet 211267



Part No: D2580-1

Job Qty: 4 pcs

Part Name: 205 Bent Tube



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 7/9/20

Job Tracking No:

Due Date: 7/23/20

Created By: Marie Lajeunesse

Type: Stock

Description:

Note: DWG D2580 REV h SHEETS 1,2,3,8 IPP B 01.11.08 Revised Step 9, 10, 12, and 13 SM IPP Rev:C 10.12.01 as per DEO D1 DD ver:ec

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
100	Skidtubes - 1	4 pcs	7/22/20		0.00	4.00	Skidtubes - 1		
							Skidtubes - 2		20-07-22
							Skidtubes - 3		
							Skidtubes - 4		CL
							Skidtubes - 5		
							Skidtubes - 6		
							Skidtubes - 7		
101	QC 5	4 pcs	7/22/20		0.00	0.00	QC 5 - 10		
							QC 5 - 12		
							QC 5 - 17		
							QC 5 - 18		BE
							QC 5 - 19		
							QC 5 - 22		20-07-22
							QC 5 - 24		
							QC 5 - 3		
							QC 5 - 43		
							QC 5 - 49		
							QC 5 - 51		
							QC 5 - 58		
							QC 5 - 68		
							QC 5 - 9		
							QC 5 - 50		
110	Handfinish - 1-1 Chemical-B4B	4 pcs	7/22/20		0.00	1.50	Handfinish - 1 - 1 - B4B		
							Handfinish - 1 - 2 - B4B		
							Handfinish - 1 - 3 - B4B		



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL.: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Container No: S290309



Part: D2580-1

Job No: 211267

Serial No/Batch: S290309

Revision: H

Inspector:

Exp Date:

Instructions: Various STC's

Date: 07/27/20

Plex 7/9/20 2:07 PM Dart.lajeunesse.marie

					Handfinish - 1 - 4 - B4B	TF July, 28, 2020
					Handfinish - 1 - 5 - B4B	
					Handfinish - 1 - 6 - B4B	
					Handfinish - 1 - 7 - B4B	
					Handfinish - 1 - 8 - B4B	
					Handfinish - 1 - 9 - B4B	
					Handfinish - 1 - 10 - B4B	
					Handfinish - 1 - 11 - B4B	
					Handfinish - 1 - 12 - B4B	
					Handfinish - 1 - 13 - B4B	
					Handfinish - 1 - 14 - B4B	
					Handfinish - 1 - 15 - B4B	
					Handfinish - 1 - 16 - B4B	
					Handfinish - 1 - 17 - B4B	
					Handfinish - 1 - 18 - B4B	
					Handfinish - 1 - 19 - B4B	
					Handfinish - 1 - 20 - B4B	
					Handfinish - 1 - 21 - B4B	
					Handfinish - 1 - 22 - B4B	
					QC 7 - 10	
					QC 7 - 13	
					QC 7 - 14	
					QC 7 - 15	
					QC 7 - 17	
					QC 7 - 18	
					QC 7 - 19	
					QC 7 - 2	
					QC 7 - 28	
					QC 7 - 3	
					QC 7 - 30	
					QC 7 - 34	
					QC 7 - 36	
					QC 7 - 37	
					QC 7 - 41	
					QC 7 - 47	
					QC 7 - 48	
					QC 7 - 51	
					QC 7 - 58	
					QC 7 - 59	
					QC 7 - 60	MLH
					QC 7 - 9	
					QC 7 - 68	W-07-30
					QC 7 - 50	
					QC 7 - 67	
					QC 7 - 40	
					QC 7 - 24	
					QC 7 - 43	
					QC 7 - 61	
120	QC 7	4 pcs	7/22/20	0.00 0.00		

					QC 7 - 81	
					QC 7 - 76	
					QC 7 - 79	
					QC 7 - 83	
					QC 7 - 82	
					QC 7 - 87	
125	Skidtubes - 2 - B4B	4 pcs	7/23/20	0.00 1.65	Skidtubes - 1 - B4B	
					Skidtubes - 2 - B4B	
					Skidtubes - 3 - B4B	MBG
					Skidtubes - 4 - B4B	
					Skidtubes - 5 - B4B	2007-30
					Skidtubes - 6 - B4B	
					Skidtubes - 7 - B4B	
130	QC 5	4 pcs	7/23/20	0.00 0.00	QC 5 - 10	
					QC 5 - 12	
					QC 5 - 17	
					QC 5 - 18	
					QC 5 - 19	
					QC 5 - 22	
					QC 5 - 24	
					QC 5 - 3	MBG
					QC 5 - 43	
					QC 5 - 49	2008-7
					QC 5 - 51	
					QC 5 - 58	
					QC 5 - 68	
					QC 5 - 9	
					QC 5 - 50	
					QC 5 - 30	
					QC 5 - 40	
					QC 5 - 61	
					QC 5 - 81	
					QC 5 - 82	
140	Packaging 3-1 - Stock - B4B	4 pcs	7/23/20	0.00 0.00	Packaging 3 - 1 - B4B	
					Packaging 3 - 2 - B4B	
					Packaging 3 - 3 - B4B	
					Packaging 3 - 4 - B4B	
					Packaging 3 - 5 - B4B	
					Packaging 3 - 6 - B4B	
					Packaging 3 - 7 - B4B	
					Packaging 3 - 8 - B4B	
					Packaging 3 - 9 - B4B	
					Packaging 3 - 10 - B4B	
					Packaging 3 - 11 - B4B	
					Packaging 3 - 12 - B4B	
					Packaging 3 - 13 - B4B	
					Packaging 3 - 14 - B4B	
					Packaging 3 - 15 - B4B	
					Packaging 3 - 16 - B4B	
					Packaging 3 - 17 - B4B	
					Packaging 3 - 18 - B4B	
					Packaging 3 - 19 - B4B	
					Packaging 3 - 20 - B4B	
					Packaging 3 - 21 - B4B	
					Packaging 3 - 22 - B4B	
					Packaging 3 - 23 - B4B	
					Packaging 3 - 24 - B4B	
					Packaging 3 - 25 - B4B	DAS
					Packaging 3 - 26 - B4B	03
						2008-7

Plex 7/9/20 2:07 PM Dart.lajeunesse.marie

150 QC 21 - SA	4 pcs	7/23/20	0.00 0.00	Packaging 3 - 27 - B4B	
				Packaging 3 - 28 - B4B	
				Packaging 3 - 29 - B4B	
				Packaging 3 - 30 - B4B	
				Packaging 3 - 31 - B4B	
				Packaging 3 - 32 - B4B	
				Packaging 3 - 33 - B4B	
				Packaging 3 - 34 - B4B	
				Packaging 3 - 35 - B4B	
				Packaging 3 - 36 - B4B	
				Packaging 3 - 37 - B4B	
				QC 21 - SA - 21	
				QC 21 - SA - 70	DAS
				QC 21 - SA - 9	21
				QC 21 - SA - 77	9-89

Part Op 100 - (Skidtube) 1- Inspect mat'l D2500-1-190 for damage. 2-Drill pilot holes using drill jig DT 8149 A-BC-D 3-Open holes
 Descriptions: to 0.508" as per Dwg D2580 4-Debur holes per QSI002 section 4.2.3 and blow out all chips from inside of tube 5- Test fit
 inspection saddles on FWD & AFT saddle holes using DT9916.

101 - (QC5- Inspect part completeness to step on W/O)

110 - (Chemical Conversion Coat per QSI005 4.1)

120 - (QC7-Inspect Chemical Conversion Coat)

125 - (Skidtube) 1- Bond web in place per QSI 015. A/R Sikaflex-291 batch: 5291905 Sikaflex expire
 date: _____ Start time and date: _____ bond for 12hrs EXP: 08-29-2020

130 - (QC5- Inspect part completeness to step on W/O)

140 - (Identify as per dwg & Stock Location: _____) LOCATION: LG002

150 - (QC21- Final Inspection - Work Order Release)

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D2500-1-190	Ext'n -I' Beam Tube 4"	4 pcs (1 ea)	100-Skidtubes - 1	<u>5282211</u>
D2596	Web, 205 Skidtube	4 pcs (1 ea)	125-Skidtubes - 2 - B4B	<u>5287497</u>

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
100-Skidtubes - 1	D2500-1-190	4	85	0
125-Skidtubes - 2 - B4B	D2596	4	2	0

Part Specifications

Specifications could not be found.

Plex 7/9/20 2:07 PM Dart.lajeunesse.marie

ITEM	QTY -041	QTY -045	QTY -047	QTY -048	PART NUMBER	DESCRIPTION
1	X				D2580-041	SKIDTUBE ASSEMBLY
2		X			D2580-045	SKIDTUBE ASSEMBLY
3			X		D2580-047	SKIDTUBE ASSEMBLY
4				X	D2580-048	SKIDTUBE ASSEMBLY
20	1	1	1	1	D2500-1-190	EXTRUSION
21			16	16	D2570	BUSHING
22	1	1	1	1	D2576-3	STEP
23		4			D2579	SPACER
24	16	16	8	8	D2594-1	PLUG
25	16	16	8	8	D2594-3	O-RING
26	1	1	1	1	D2596	205 WEB
27	1	1	1	1	D2555	AFT CAP
28	1	1			D3584-5	WEARSHOE
29	1	1			D3584-9	WEARSHOE
30	1	1			D3584-11	WEARSHOE
31	1	1			D3584-13	WEARSHOE
32	20	20	24	24	D4202-1	SPACER
33			1		D4406-041	WEARPLATE ASSEMBLY
34			1		D4408-043	WEARPLATE ASSEMBLY
35				1	D6061-1	FWD WEARPLATE
36				1	D6061-3	AFT WEARPLATE
60	60	60			ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
61	60	60			AN3CA	BOLT
62	2	2	2	2	AN3-5A	BOLT
63			8	8	AN4-45A	BOLT
64	60	60			NAS1149C0332R	WASHER (AN680C10L)
65	2	2	2	2	NAS1149D0332J	WASHER (AN680JD10L)
66			8	8	MS21042-4	NUT (OR MS21042L4)

GENERAL NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT (-041/-047/-049) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
POWDER COAT (-045) GREEN SANDTEX (REF 4.3.5.8) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D2580-041 = 33.7 lbs
D2580-045 = 33.7 lbs
D2580-047 = 45.1 lbs
D2580-048 = 32.0 lbs
- 8) WELDING PER DART QSI 004.
- 9) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 10) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 11) USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL 20.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3CA BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241-291.
- 12) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047/-048)
- 13) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2555 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 211267 MWS
2007 CR


RELEASED

2017 JUL 05 4P
BENTLEY-SLR


H	SHEET: PL DELETE D3586-1/-5/-13 GASKETS, WEIGHTS UPDATED ACCORDINGLY. SHEETS 2 & 4 PICTORIAL UPDATE FOR REMOVAL OF GASKETS	SAD	17.06.09
G	ADDED -048, -047 WEIGHT UPDATED PER DSI 8996	AJS	14.04.09
F	INCORPORATE DEO D2580-E-1 PER PAR12-218	DC	13.08.20
E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-5); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.08.21
D	CHANGE TO 88 WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.06
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	06.06.26
B	AS MANUFACTURED	DS	06.12.02
A	NEW ISSUE	DS	06.06.16
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 1 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

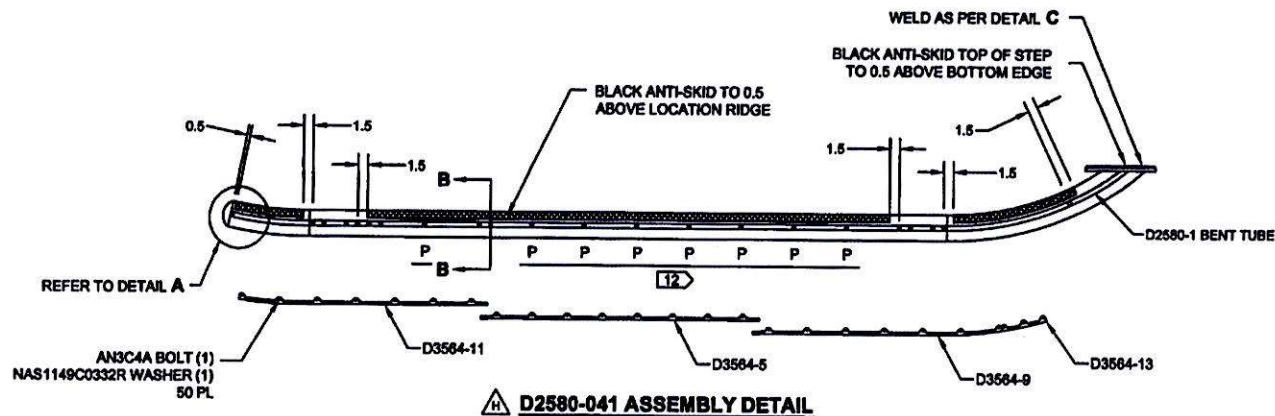


DETAIL A
SCALE 5X

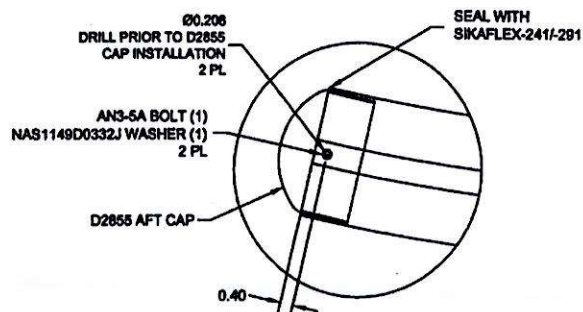

SECTION B-B
SCALE 5X

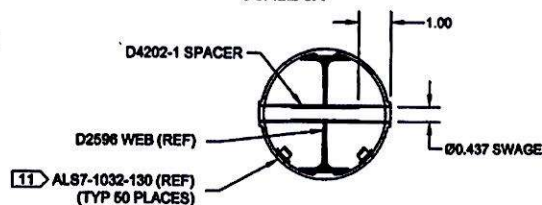


DETAIL C
SCALE 5X

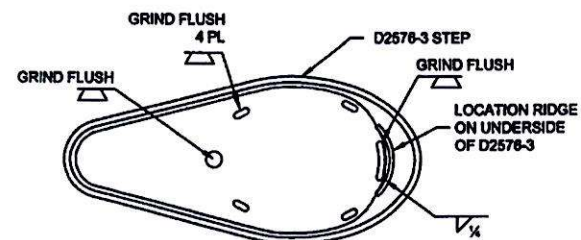

RELEASED

2017 JUL 05


DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 2 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD	

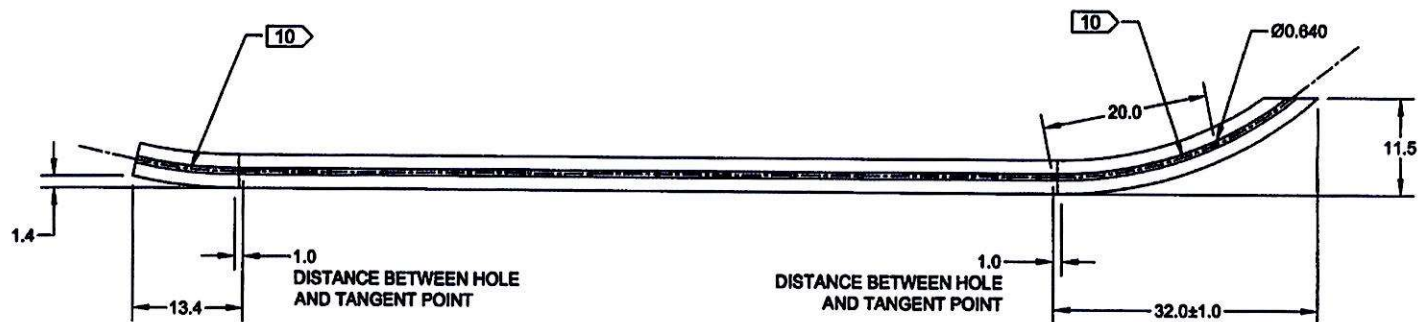

D2580-1 BENT TUBE
(MAKE FROM D2580-10T TUBE)


RELEASED
2017 JUL 05 *4P*

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 3 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR FOR ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

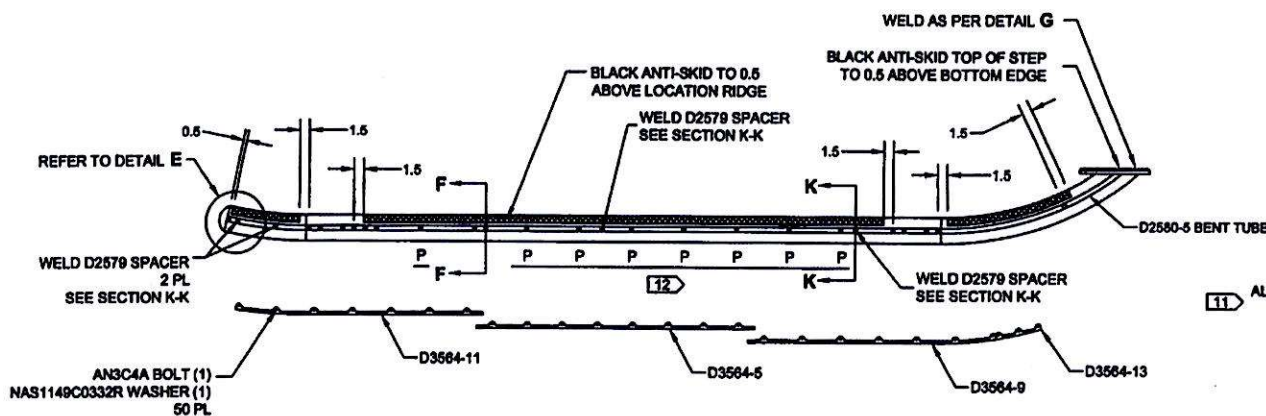


D2580-045 ASSEMBLY DETAIL

**SECTION K-K
SCALE 5X**

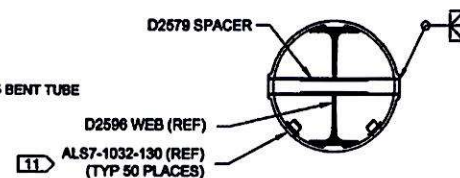


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (4 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. DO NOT C'BORE

**DETAIL E
SCALE 5X**

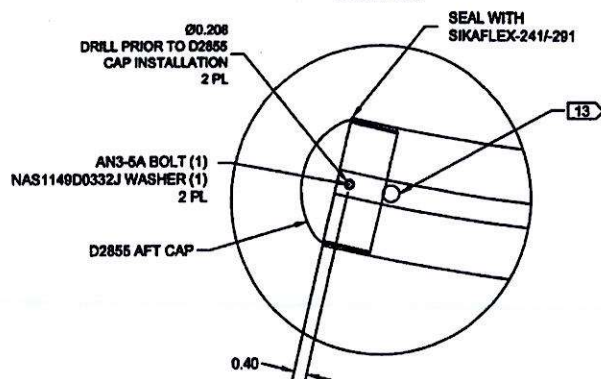


**SECTION F-F
SCALE 5X**

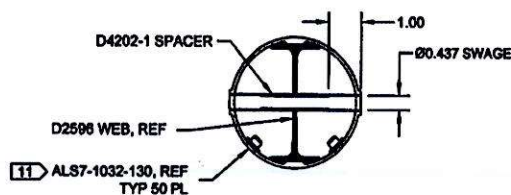


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (20 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

**DETAIL G
SCALE 5X**

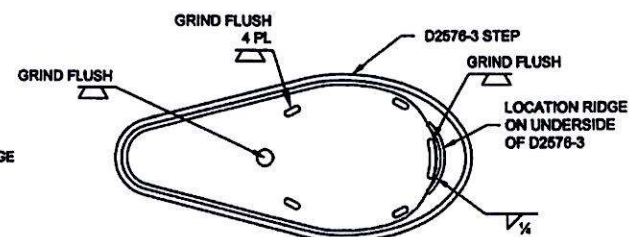

RELEASED
2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 4 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1994 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			




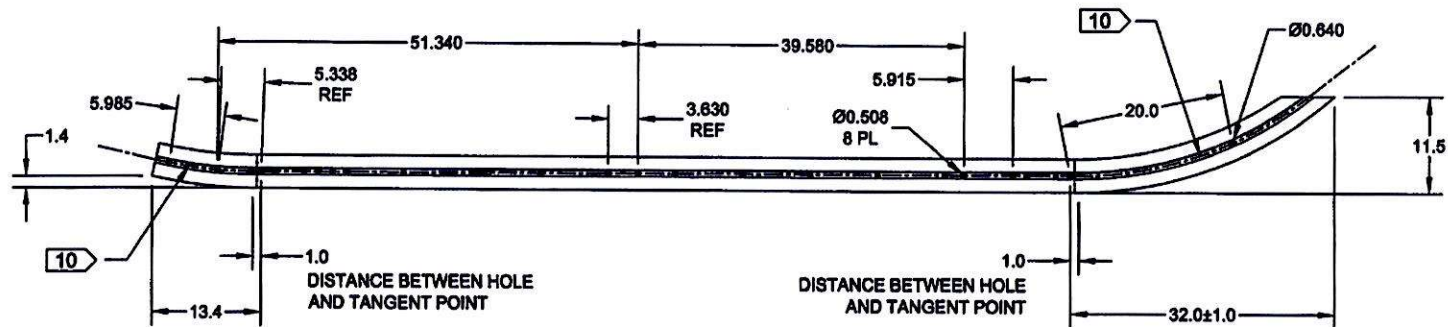


D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED

2017 JUL 05 *AD*

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 6 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

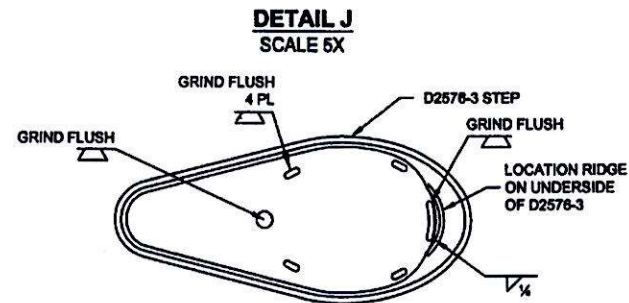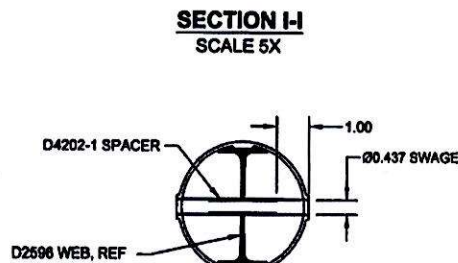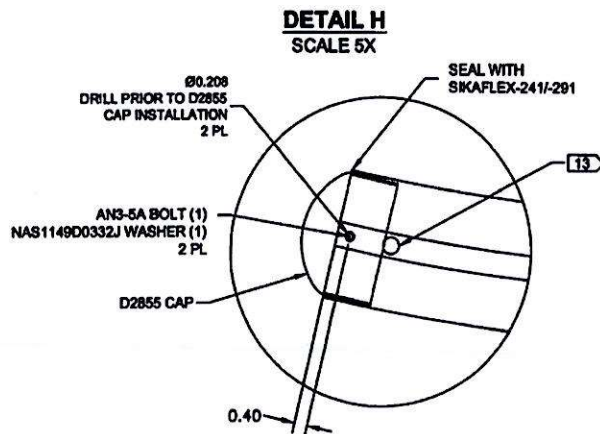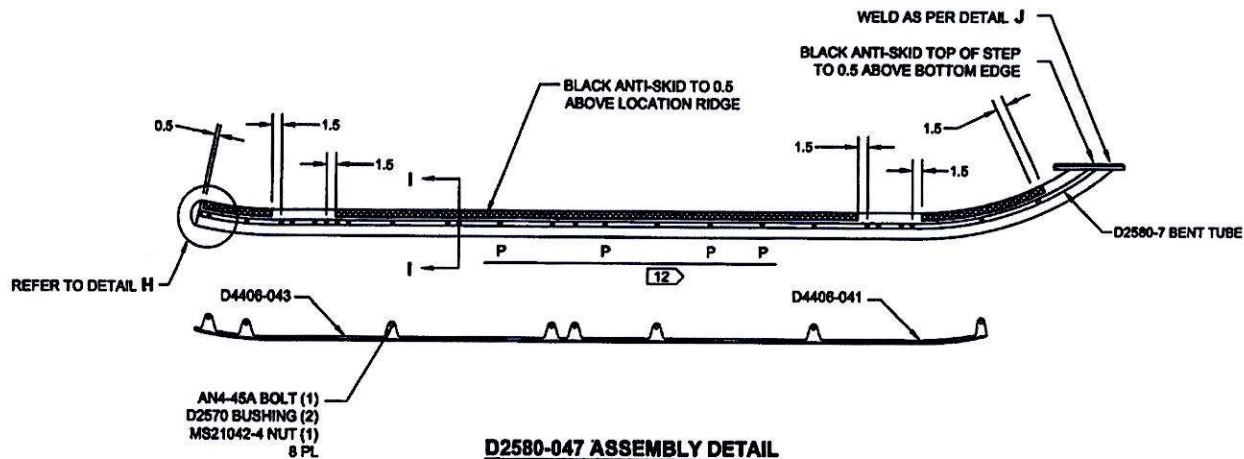


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (24 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002


RELEASED

2017 JUL 05 4P


DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 6 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES (AS COVERED BY COPIES) WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

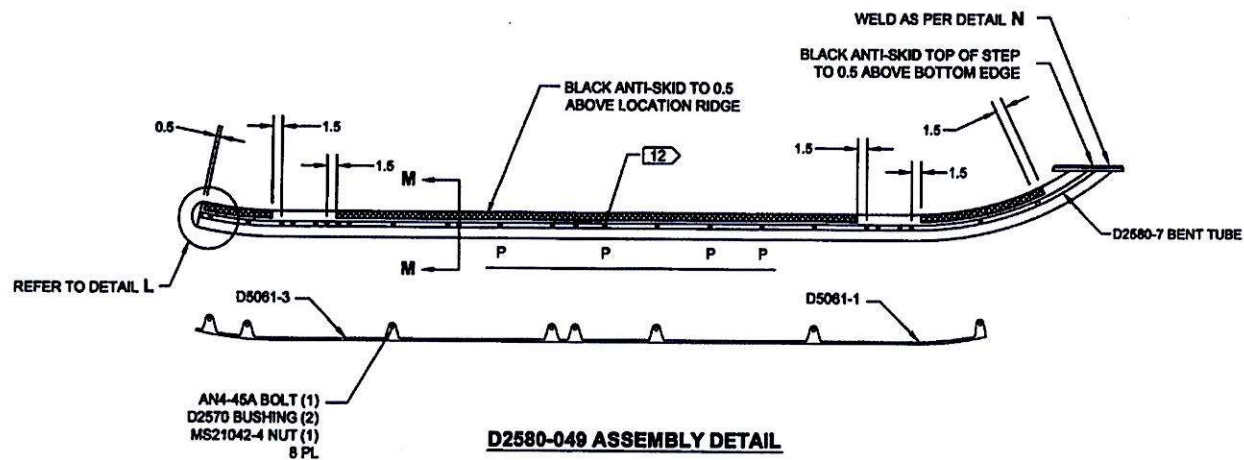

D2580-049 ASSEMBLY DETAIL

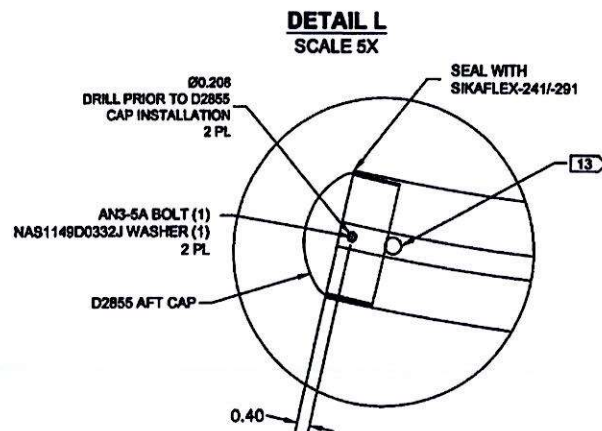


**DETAIL L
SCALE 5X**

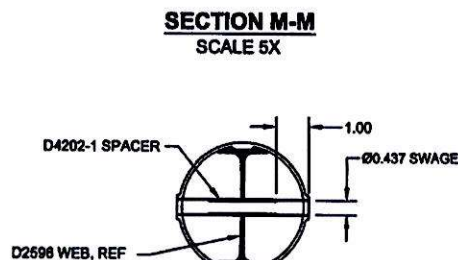

**SECTION M-M
SCALE 5X**

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (24 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

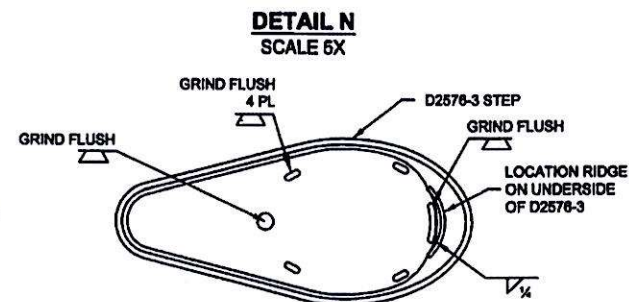


**DETAIL N
SCALE 5X**

RELEASED

2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 7 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DRAWING IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE LOANED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

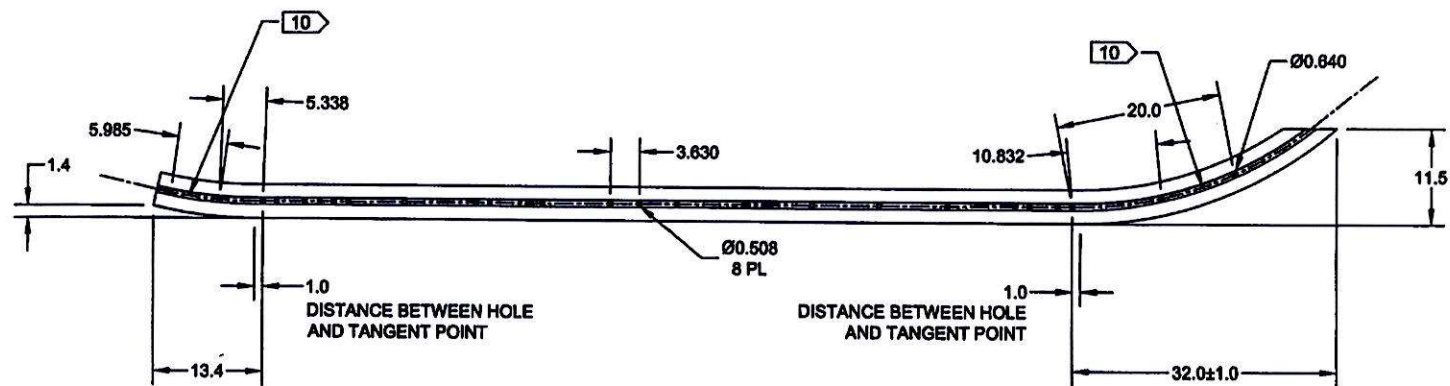


D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)


RELEASED

2017 JUL 05 *q*

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 8 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1999 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

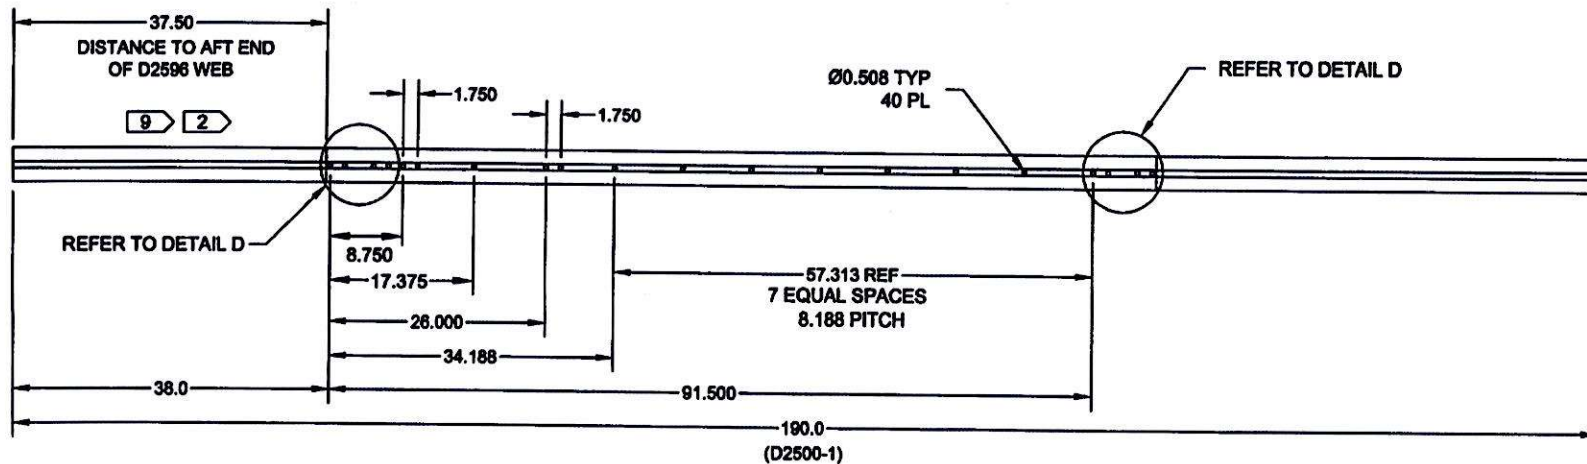

D2580-101 TUBE

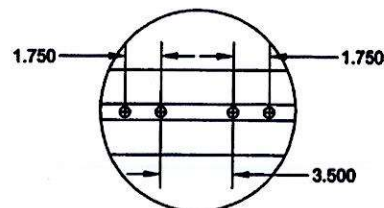

DETAIL D
SCALE 5X

RELEASED

2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 9 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1988 BY DART AEROSPACE LTD THIS DOCUMENT IS PRELIMINARY AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					